

Manhole Inspection Summary

Manhole # S25S__003MH

Printed On: 1/15/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **25S** Node: **003** Status: **Found**

Insp Date: **4/11/08 10:18 AM**

Incomplete Comments

Crew: **FW/DH**
Inspector: **dhinton**
Firm: **PER**

Location Address: **1500 WICOMICO ST.**

Cross Street: **BUSH ST.**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **4** Missing: **0** ☒ Corroded

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S25S__003MH

Printed On: 1/15/2009

Page 2 of 4

Location View



Top View



Defect 4



DETERIORATED BENCH

Defect 3



EVIDENCE OF CORBEL INFILTRATION
BECAUSE OF MISSING MORTAR

Defect 1



EVIDENCE OF CHIMNEY
INFILTRATION, MISSING MORTAR

Defect 5



corroded steps

Manhole Inspection Summary


Manhole # S25S__003MH

Printed On: 1/15/2009

Page 3 of 4

10 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

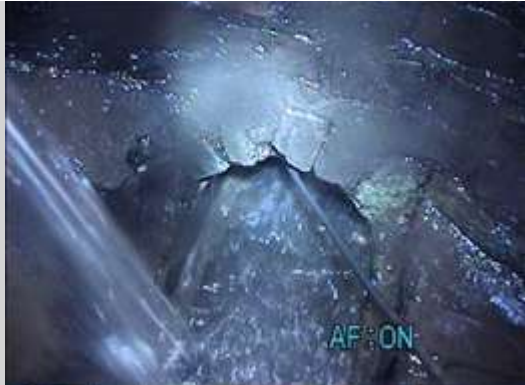

Pipe Height: **10.8** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.43** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **Evidence** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.55** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S25S__003MH

Printed On: 1/15/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe In @ 9 OClock

9 O'Clock Inflow

Drop In @ 9 OClock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.21** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop: Outside	Rod and Bar
Angled: Yes	Reading: 7.38 (ft.)
	Inv Depth: 8.38 (ft.)
Drop Condition: Open	

Connects To: **House connection / Service line**

☐ Possible Illicit Connection